

Work Order ID: 71464

Monday, July 04, 2011 1:31:28 PM



Page 1

Item ID: D3391-023

Accept



Setup Start



Revision ID:

Stop



Item Name: Mid Tube Assembly

Start Date: 7/5/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 7/19/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals:

Process Plan: ME

Date: 11-07-04 Tooling:

Date:

Run Start



QC:

Date:

SPC (Y/N):

Date:

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D3391

Rev H

100

0.00



Skidtubes

Skidtubes

Memo

0.00

Skidtubes

1-Cut tube to finish length as per Dwg D3391

2-Identify as D3391-023

3-Drill pilot holes using DT8796 (Do not drill "B" holes) and drill only 1 fwd saddle hole on one side only as per Dwg D3391

4-Open saddles and GHW holes to Ø0.375" except for fwd saddle hole of detail "J"

5-Remove .030" from Fwd indexing Ridge as per Dwg D3391

6-Remove indexing ridge on Fwd & Aft end of skidtube as per Dwg D3391

7-Deburr

8-Drill #30 pilot holes using wearplate Jig DT8217 Identify Ø0.250" holes with paint marker,

9-Open wearplate holes of D3391-023 assembly detail section G-G to Ø0.250" (14 holes) as per Dwg D3391 and 2 holes in section Detail "J", do not open wearplate holes of section "J"

10-Open wearplate holes of D3391-023 assembly detail section H-H to Ø0.297" (20 holes) as per Dwg D3391

11/09/19

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 71464

Monday, July 04, 2011 1:31:28 PM



Page 2

Item ID: D3391-023

Accept



Setup Start



Revision ID:

Item Name: Mid Tube Assembly

Stop



Start Date: 7/5/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 7/19/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

11-Open .375" holes to .438" ***do not open fwd saddle holes***



11/09/19

12-Locate D3391-021 in D3391-023 at 9.00" (see view z-z)

13- Transfer drill one fwd saddle hole only to .188" dia, transfer drill all remaining fwd saddle holes using DT 8149 locating from previously drill .188" dia hole, using t-pins and clicos to ensure perfect allingment, open up previously tranfer drilled pilot holes in D3391-023/-021 to 0.438" dia. in D3391-021

14- Transfer drill 2 wearplate holes into D3391-021 using DT8217, locating from two previously drilled holes, drill remaining wearplate holes into D3391-021.



11-11-1

15- Locating from two fwd wearplate holes drilol remaining 6 wearplte holes in D3391-021 using DT8937

16- Open 2 fwd wearplate holes in D3391-023 to .250" dia.

17- counterbore two aft wearplate holes in D3391-021 as per dwg

18- Open 12 wearplate holes in D3391-021 to 0.297" dia.

19-Deburr and blow out all chips from inside tube

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

H:\FORMS\Quality Assurance\approved QAWCRWO RevE

Work Order ID 71464

Page 3

Monday, July 04, 2011 1:31:28 PM

Item ID: D3391-023

Accept



Setup Start



Revision ID:

Item Name: Mid Tube Assembly

Stop



Start Date: 7/5/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 7/19/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start



QC:

Date:

SPC (Y/N):

Date:

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
110 QC Quality Control	QC5- Inspect part completeness to step on W/O Memo	0.00 0.00				<u>11</u>	<u>11</u>	<u>01</u>	<u>①</u>
120 HandFinish Hand Finishing	Chemical Conversion Coat per QSI005 4.1 Memo	0.00 0.00				<u>SAD</u>	<u>11-11-01</u>	<u>1</u>	<u>①</u>
130 QC Quality Control	QC3- Inspect Part Finish Memo	0.00 0.00				<u>DP</u>	<u>11-11-2</u>		

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 71464

Monday, July 04, 2011 1:31:28 PM



Page 4

Item ID: D3391-023
Revision ID:
Item Name: Mid Tube Assembly

Accept



Setup Start



Stop



Start Date: 7/5/2011 Start Qty: 1.00
Required Date: 7/19/2011 Req'd Qty: 1.00



Cust Item ID:

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start



Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
140 Skidtubes	Skidtubes	0.00							
	Memo	0.00		3125					(1) SAD 11-11-02
	1-Open float bag holes as per dwg 2-C'sink float bag holes as per dwg 3- Prepare tube for welding 4-Bond web in place as per Dwg D3391 & QSI 015. Adhere for 12 hours) A/R Sikaflex exp: 12-08-13 batch#: m119399								
150 QC	QC5- Inspect part completeness to step on W/O	0.00							
Quality Control	Memo	0.00							1 0 BEU/11/04 ⁰³
160 Skidtubes	Skidtubes	0.00							
	Memo	0.00							1 0 BEU/11/04 ⁰³
	1-Weld crossbolt spacer as per dwg D3391 & QSI 004 2-grind weld flush								AR m118736 SAD 11-11-03

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

H:\FORMS\Quality Assurance\approved QA\NCRWO RevE

Work Order ID 71464

Monday, July 04, 2011 1:31:28 PM



Page 5

Item ID: D3391-023

Accept



Setup Start



Revision ID:

Stop



Item Name: Mid Tube Assembly

Start Date: 7/5/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 7/19/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals:

Process Plan: _____

Date: _____

Tooling: _____

Date: _____

Run Start



QC: _____

Date: _____

SPC (Y/N): _____

Date: _____

Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

170



QC

Quality Control

QC10- Inspect visual per QSI004- ground welds

0.00

Memo

0.00

11-11-04

1 0

180



QC

Quality Control

QC5- Inspect part completeness to step on W/O

0.00

Memo

0.00

11-11-04

185



HandFinish

Hand Finishing

Pressure Wash per QSI005 4.3

0.00

Memo

0.00

AND REALODINE AS PER PAR09-043

IX 11-11-08

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 71464

Monday, July 04, 2011 1:31:28 PM



Page 6

Item ID: D3391-023

Accept



Setup Start



Revision ID:

Stop



Item Name: Mid Tube Assembly

Start Date: 7/5/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 7/19/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start



QC:

Date:

SPC (Y/N):

Date:

Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

190

White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum

0.00



Powdercoat

Powder Coating

Memo

START TIME:

OVEN TEMPERATURE:

FINISH TIME:

0.00

9:30
320°F

10:00

12/2 m-f 11/11/09

200

QC3- Inspect Part Finish

0.00



QC

Quality Control

Memo

0.00

1 0 11/11/09

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Monday, July 04, 2011 1:31:28 PM

Page 7



The following information is provided for the purpose of identifying the person or persons who are responsible for the preparation of the financial statements. It is not intended to be used for any other purpose. The information is provided for the purpose of identifying the person or persons who are responsible for the preparation of the financial statements. It is not intended to be used for any other purpose.

Stop

Item Name: Mid Tube Assembly

Abstract

Cust Item ID:

1

Customer:

Reference:

Stop

Tooling:

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

SPC (Y/N):

Set Up/ Run Hours

Tool ID	Tool #	Plan Code
---------	--------	-----------

Accept Qty	Reject Qty	Reject Number	Insp. Stamp
---------------	---------------	------------------	----------------

0.00

[illegible]

Skidtubes

0.00

Skidtubes

Skidtubes

Memo

1- insert D3391-021 into D3391-23

2-insert T-pins into first and third fwd saddle holes

✂- ON FIRST SIDE ONLY drill out 2nd and forth fwd saddles holes to 0.500" as per DSI 9364

4- remove T-pins and locate DT9415 from first and third crossbolt hole using T-pins and clekos

5- ON 2ND SIDE ONLY ream out 2nd and forth saddle hole to 0.499". Remove
DT9415

6- deburr, re-alodine and blow out chips

7- press fit D3591-1 spacers using DT9416 starting from 0.500" side

220

QC5- Inspect part completeness to step on W/O	0.00
---	------

0.00

Abstract

QC

Memo

0.00

Quality Control

1 6 11 11 11 14

 11 11 784 (1)

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 71464

Monday, July 04, 2011 1:31:28 PM



Page 8

Item ID: D3391-023

Accept



Setup Start



Revision ID:

Item Name: Mid Tube Assembly

Stop



Start Date: 7/5/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 7/19/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
230		0.00							
	HandFinishing								
HandFinish	Memo	0.00							
Hand Finishing	Install Inserts as per Dwg								
240		0.00							
	QC5- Inspect part completeness to step on W/O								
QC	Memo	0.00							
Quality Control									
250		0.00							
	Identify as per dwg & Stock Location: <u>wlo</u>								
Packaging	Memo	0.00							
Packaging									

0412-742-043/1375590 1 0 all ululzz

1--

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 71464

Monday, July 04, 2011 1:31:28 PM



Page 9

Item ID: D3391-023

Accept



Setup Start



Revision ID:

Stop



Item Name: Mid Tube Assembly

Start Date: 7/5/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 7/19/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals:

Process Plan: _____

Date: _____

Tooling: _____

Date: _____

Run Start



QC: _____

Date: _____

SPC (Y/N): _____

Date: _____

Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

260

QC21- Final Inspection - Work Order Release

0.00



QC

Memo

0.00

Quality Control

11/11/28 [Signature]
mf
11-11-28

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Monday, July 04, 2011 1:31:26 PM

Page 1

Work Order ID: 71464

Parent Item: D3391-023

Parent Item Name: Mid Tube Assembly

Start Date: 7/5/2011

Required Date: 7/19/2011

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP A 05.10.20 New Issue KJ/EC
 IPP B 06.02.10 ECN773 dwg rev.D EC
 IPP C 07.03.20 rev F dwg EC
 IPP D 07.03.28 re-format EC
 IPP E 07.10.31 ecn 1053P EC
 IPP Rev:F ECN 1056 07-11-13 DD verified by: EC
 IPP Rev:G 08-09-08 new process (ecn 08-510) DD verified by:EC
 IPP Rev:H 08-09-10 revH as per dwg DD verified by:EC
 IPP Rev: I 08-11-13 Removed steps per w/o, QC KJ verified by: ec IPP
 Rev:J add in seq 140 expire date &# sika flex DD 10.02.17 verified by:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D2500-1-100



Skidtube Extrusion

Manufactured

No

100

Each

79.0000

1



①

11/09/16

Location

Loc Qty

Loc Code

HALL

79

37065

4

50251

75

D3391-021



Fwd Tube Assembly

Manufactured

No

100

Each

0.0000

1



1

① DP 11/11

D3389-1



Web

Manufactured

No

140

Each

1.0000

1



1

SAD 11-11-02

Location

Loc Qty

Loc Code

LG

1

71333

1

B73433

①

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Monday, July 04, 2011 1:31:26 PM

Work Order ID: 71464

Parent Item: D3391-023

Parent Item Name: Mid Tube Assembly

Start Date: 7/5/2011

Required Date: 7/19/2011

Start Qty: 1.00

Required Qty: 1.00

D3681-1 Manufactured No

160 Each

9.0000 5 5



Spacer

Location

Loc Qty

Loc Code

LG

9

68958

2

69893

7

D3591-1 Manufactured No

210 Each

27.0000 2 2



Bushing

Location

Loc Qty

Loc Code

ST068

27

57350

2

66147

25

ALS4-1032-130 Purchased No

230 Each

1,002.000 20 20



Insert

ALS4-1032-130

Location

Loc Qty

Loc Code

ST281

8

117331

8

ST282

994

117717

994

BE 7/11/04
B 71845 r5

ul ul ul ul

x2

ul ul ul ul

M119530

x20


Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

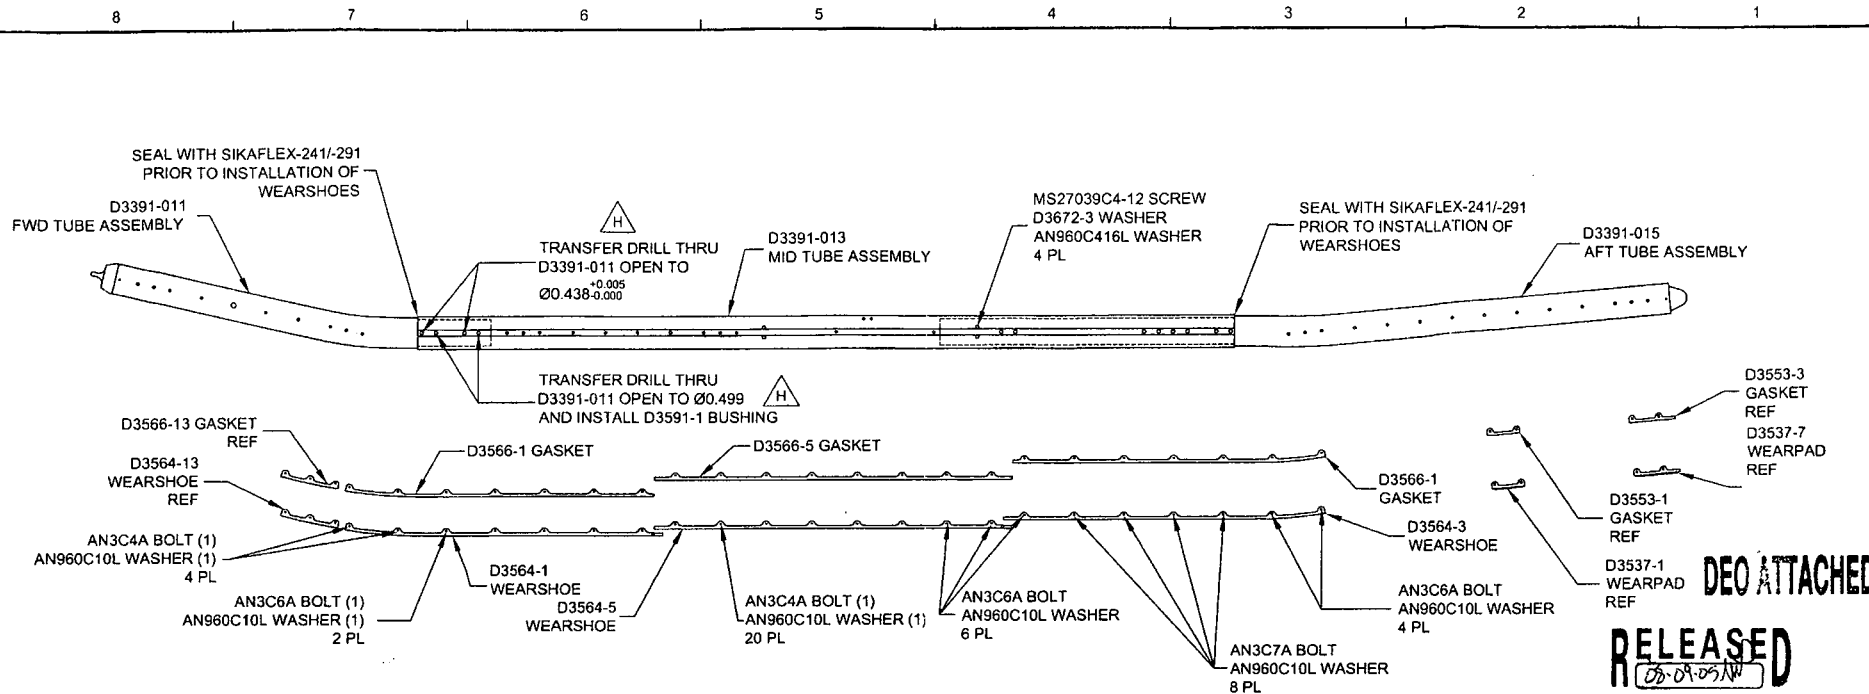

D3391-041 ASSEMBLY

DEO ATTACHED

RELEASED
08-08-20

D3391-041 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
1	D3391-041	FLOAT SKIDTUBE ASSEMBLY
1	D3391-011	FWD TUBE ASSEMBLY
1	D3391-013	MID TUBE ASSEMBLY
1	D3391-015	AFT TUBE ASSEMBLY
1	D3564-1	WEARSHOE
1	D3564-3	WEARSHOE
1	D3564-5	WEARSHOE
2	D3566-1	GASKET
1	D3566-5	GASKET
2	D3591-1	BUSHING
2	D3672-3	WASHER
24	AN3C4A	BOLT
12	AN3C6A	BOLT
8	AN3C7A	BOLT
44	AN960C10L	WASHER
4	MS27039C4-12	SCREW
4	AN960C416L	WASHER

GENERAL NOTES

- FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- UNITS: INCHES UNLESS OTHERWISE NOTED
- USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES FOR WEARSHOE INSERTS. C-BORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.

71464

REV.	DESCRIPTION	BY	DATE																										
H	DRAWING UPDATED TO CURRENT STANDARDS. SHT 1 PL ADDED D3591-1 BUSHING. ZN C6 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. SHT 2 PL ADDED D3591-1 BUSHING. ZN C6 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. (FOR FURTHER INFO SEE DSI 9364 & NCR 08-074)	AJS	08.08.20																										
G	REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY	DC	07.07.31																										
F	ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011/-021	PH	07.01.18																										
E	CHANGE TOLERANCE, EASE MANUFACTURE	PH	06.04.25																										
D	UPDATE TOLERANCE, CHANGE HOLE SIZE	PH	06.01.23																										
C	LENGTHEN AFT EXTENSION	PH	05.09.27																										
B	DRAWING UPDATES	PH	05.06.10																										
A	NEW ISSUE	PH	05.02.07																										
<table border="1"> <tr> <td>DESIGN</td><td>PH</td><td colspan="2" rowspan="2"> DART AEROSPACE USA, INC PORT HADLOCK, WA </td></tr> <tr> <td>DRAWN</td><td>AJS</td></tr> <tr> <td>CHECKED</td><td></td><td>DRAWING NO.</td><td>REV. H</td></tr> <tr> <td>MFG. APPR.</td><td></td><td>D3391</td><td>SHEET 1 OF 8</td></tr> <tr> <td>APPROVED</td><td></td><td>TITLE</td><td>SCALE</td></tr> <tr> <td>DE APPR.</td><td></td><td>412 FLOAT SKIDTUBE</td><td>NTS</td></tr> <tr> <td>DATE</td><td>08.08.20</td><td colspan="2"> COPYRIGHT © 2005 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC. </td></tr> </table>				DESIGN	PH	DART AEROSPACE USA, INC PORT HADLOCK, WA		DRAWN	AJS	CHECKED		DRAWING NO.	REV. H	MFG. APPR.		D3391	SHEET 1 OF 8	APPROVED		TITLE	SCALE	DE APPR.		412 FLOAT SKIDTUBE	NTS	DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	
DESIGN	PH	DART AEROSPACE USA, INC PORT HADLOCK, WA																											
DRAWN	AJS																												
CHECKED		DRAWING NO.	REV. H																										
MFG. APPR.		D3391	SHEET 1 OF 8																										
APPROVED		TITLE	SCALE																										
DE APPR.		412 FLOAT SKIDTUBE	NTS																										
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.																											

Dart Aerospace Ltd


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

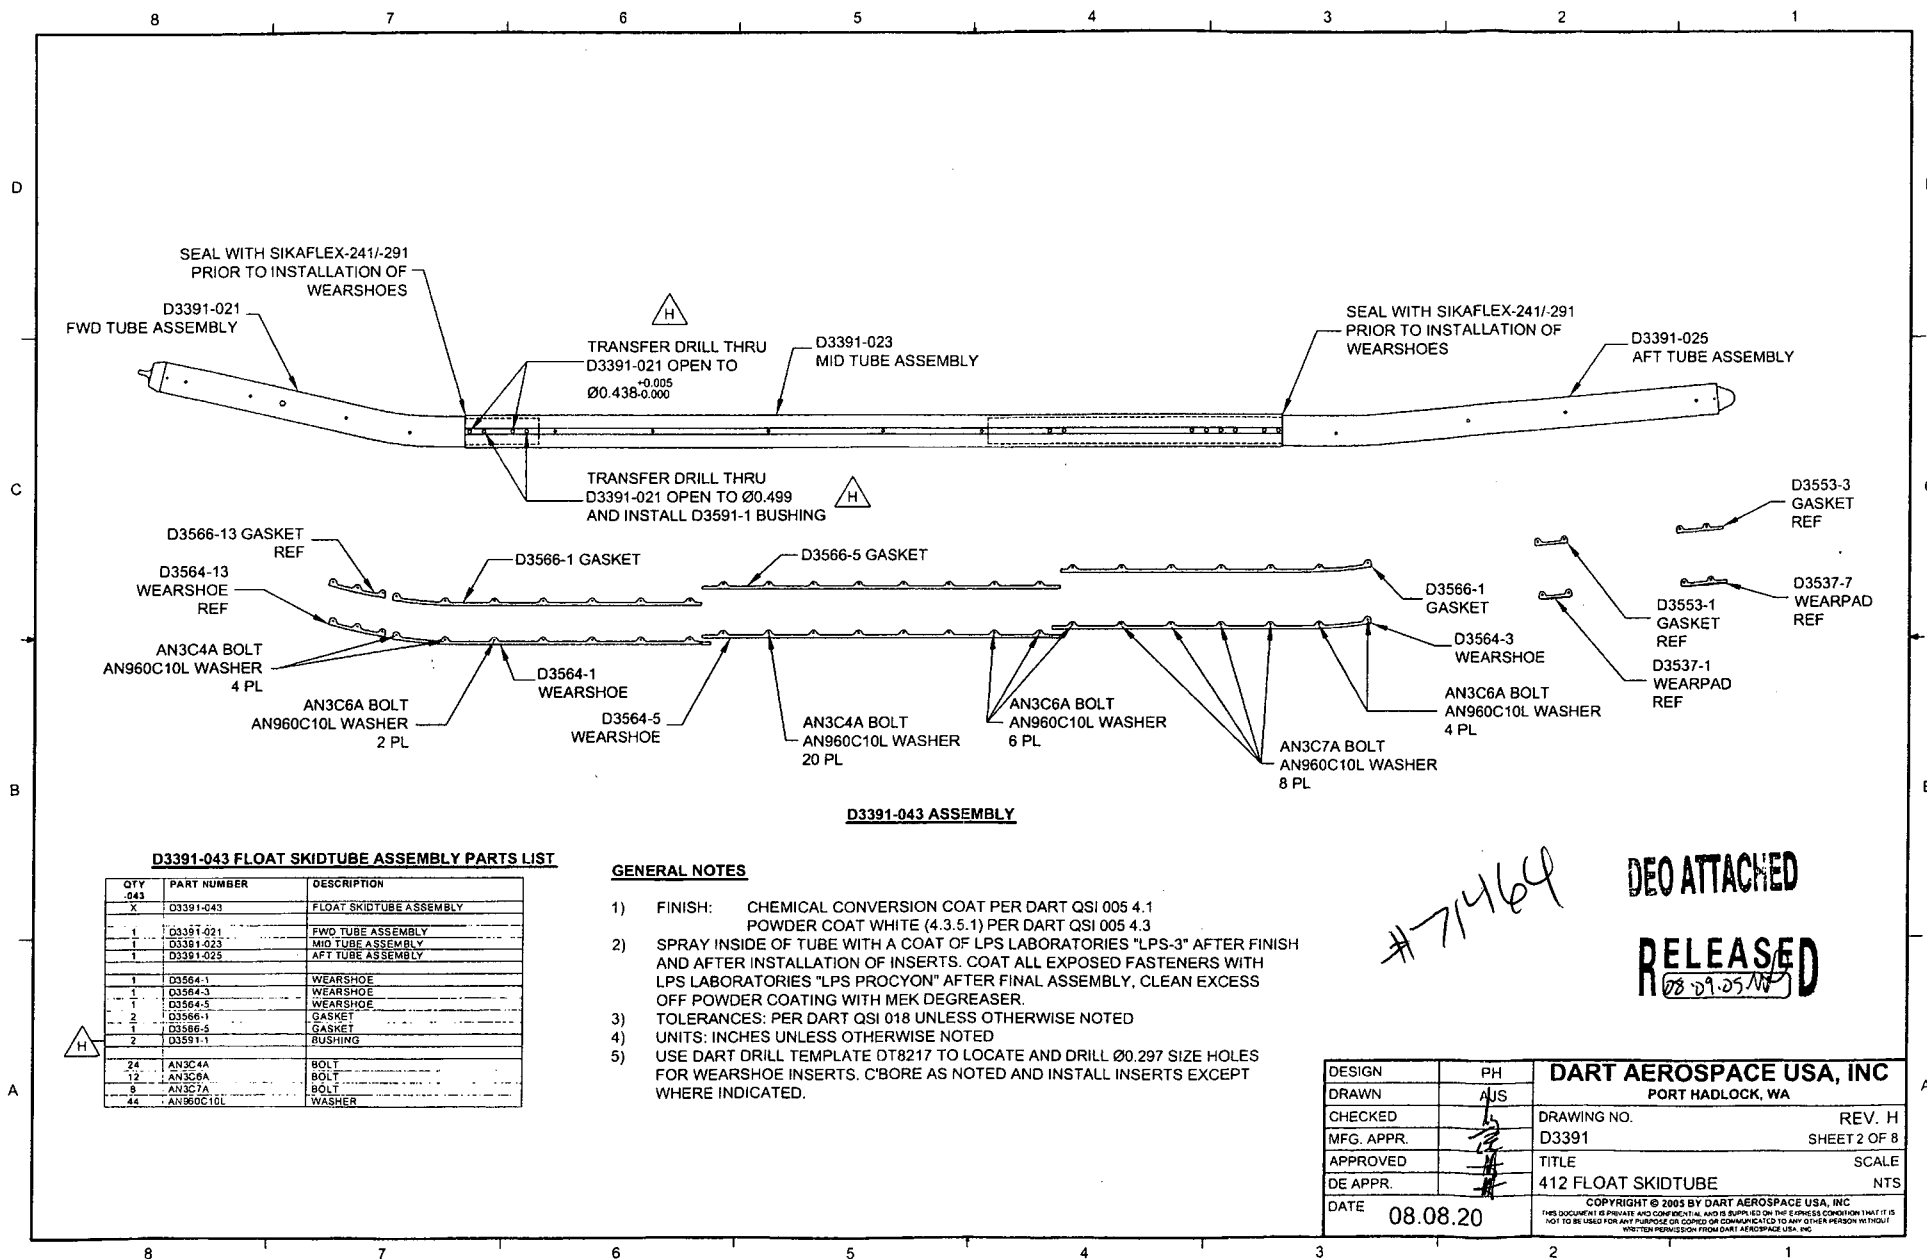


Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


NOTE: Date & initial all entries

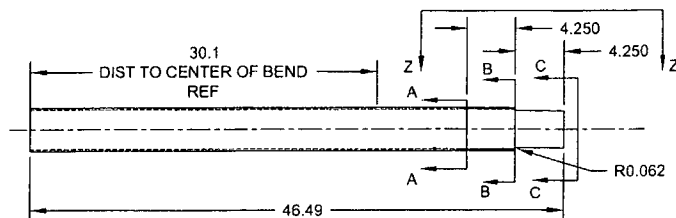


D3391-1 CUTTING DETAIL
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

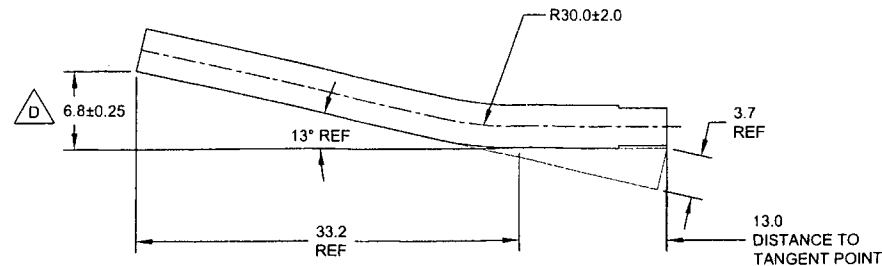


D3391-011/-021 BENDING DETAIL
(MAKE FROM D3391-1)

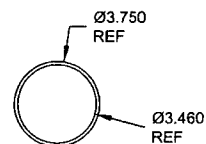


SECTION A-A
SCALE 2X

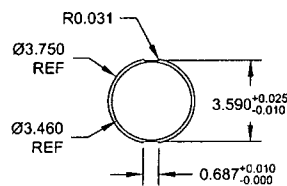

SECTION B-B
SCALE 2X

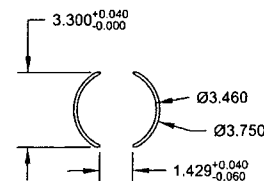

SECTION C-C
SCALE 2X

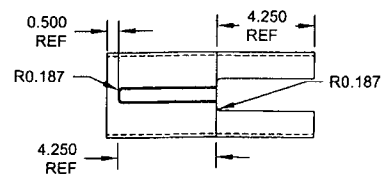

VIEW Z-Z
SCALE 2X

471464

DEO ATTACHED
RELEASED
28 JAN 05 NW

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 3 OF 8
APPROVED	JAN	TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			


Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

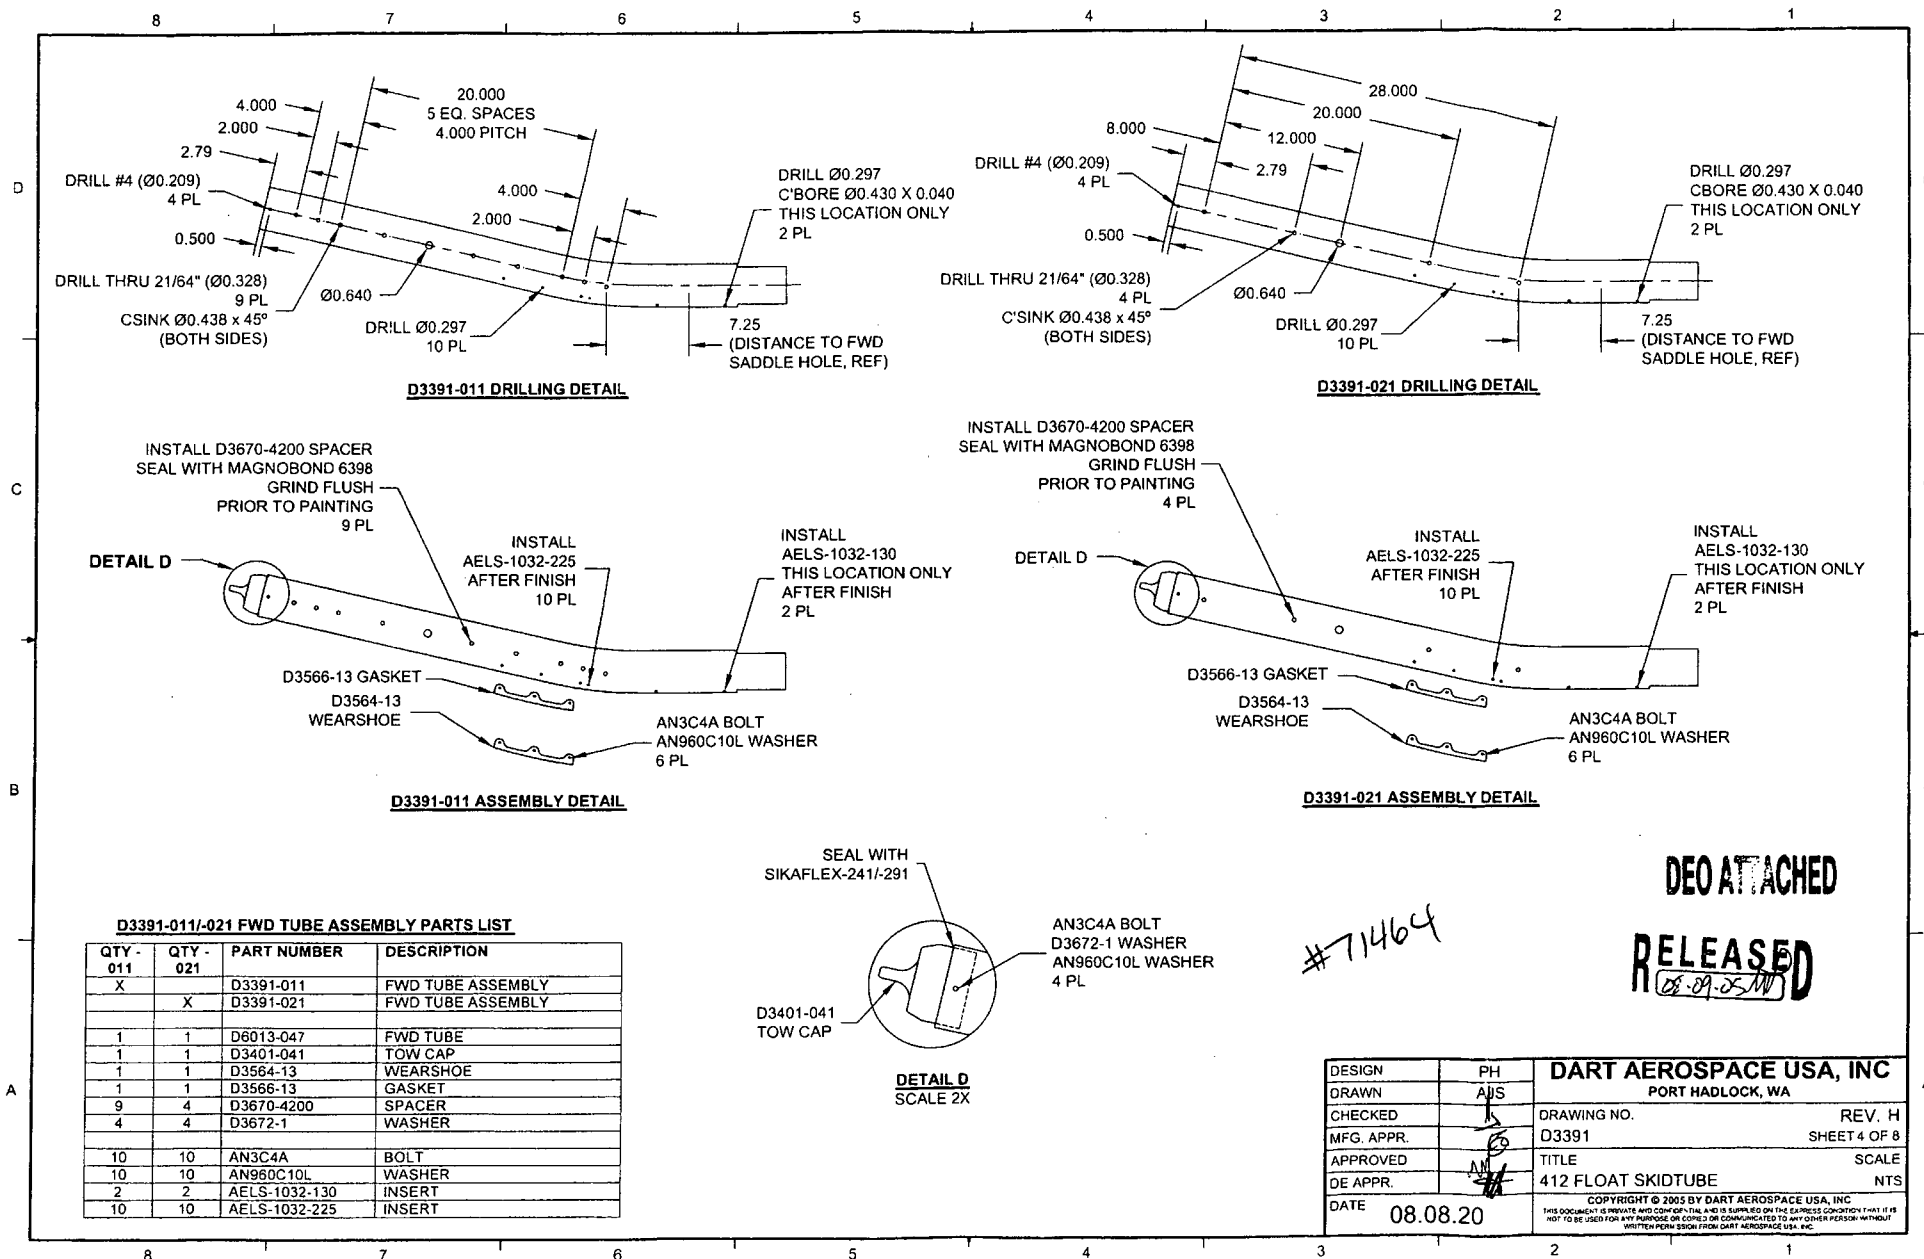

Dart Aerospace Ltd


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


NOTE: Date & initial all entries

8 7 6 5 4 3 2 1

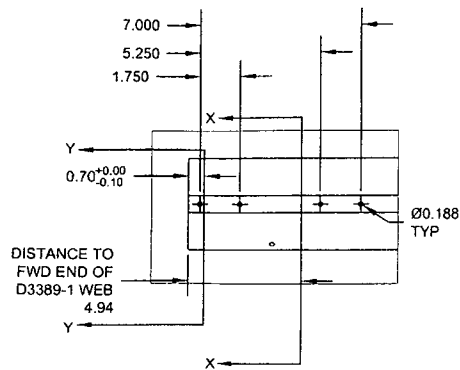


DETAIL J
SCALE 4X

DRILL THRU 21/64" (Ø0.328)
CSINK Ø0.438 X 45° (BOTH SIDES)
12 PL

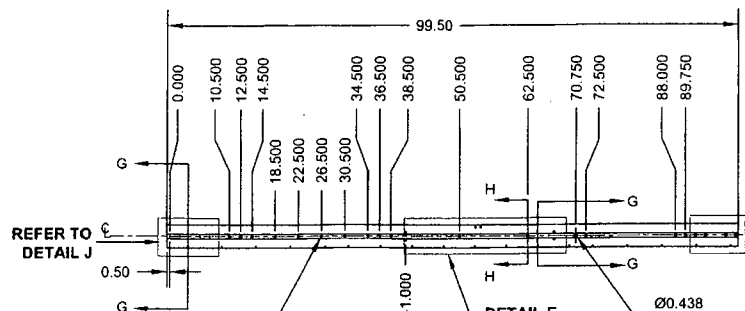


D3391-013 ASSEMBLY DETAIL

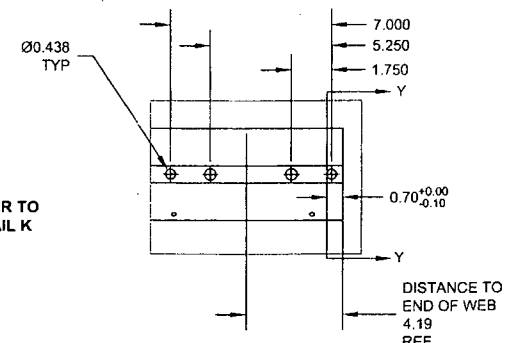


DETAIL K
SCALE 4X




SECTION G-G
SCALE 5X

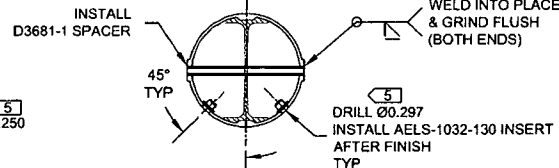

SECTION H-H
SCALE 5X

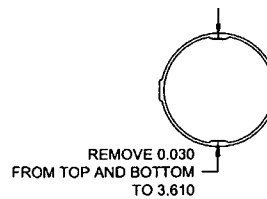

SECTION X-X
SCALE 5X

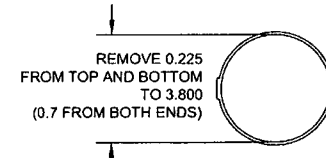


SECTION Y-Y
SCALE 5X

D3391-013 MID TUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
-013	D3391-013	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
4	D3672-1	WASHER
4	D3672-3	WASHER
12	D3681-1	SPACER
24	AELS-1032-130	INSERT
4	ALS4-428-165	INSERT
4	AN960C10L	WASHER
4	AN960C416L	WASHER
4	MS27039C1-09	SCREW
4	MS27039C4-08	SCREW


D3391-013 MID TUBE ASSEMBLY

- MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/291 PER QSI 015
- WELDING: PER DART QSI 004

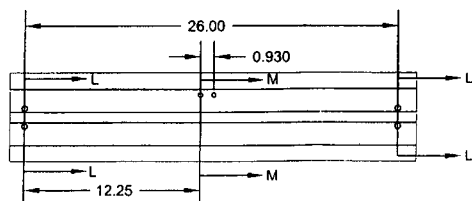


DETAIL E
SCALE NONE

DRILL Ø0.391
INSTALL ALS4-428-165 INSERT
MS27039C4-08 SCREW
D3672-3 WASHER
AN960C416L WASHER
AFTER FINISH
4 PL

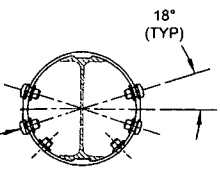


SECTION L-L
SCALE 5X

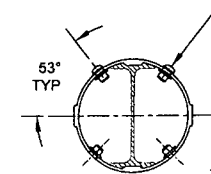

SECTION M-M
SCALE 5X

DRILL Ø0.297
INSTALL AELS-1032-130 INSERT
MS27039C1-09 SCREW
D3672-1 WASHER
AN960C10L WASHER
AFTER FINISH
4 PL

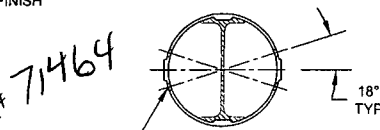

SECTION LL-LL
SCALE 5X

#71464
DEO ATTACHED
RELEASED

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 5 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC	

8 7 6 5 4 3 2 1


Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


NOTE: Date & initial all entries

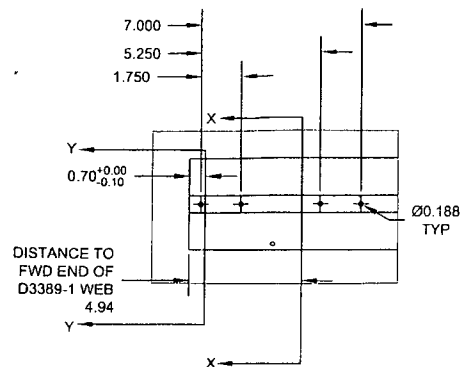

DETAIL J
SCALE 4X

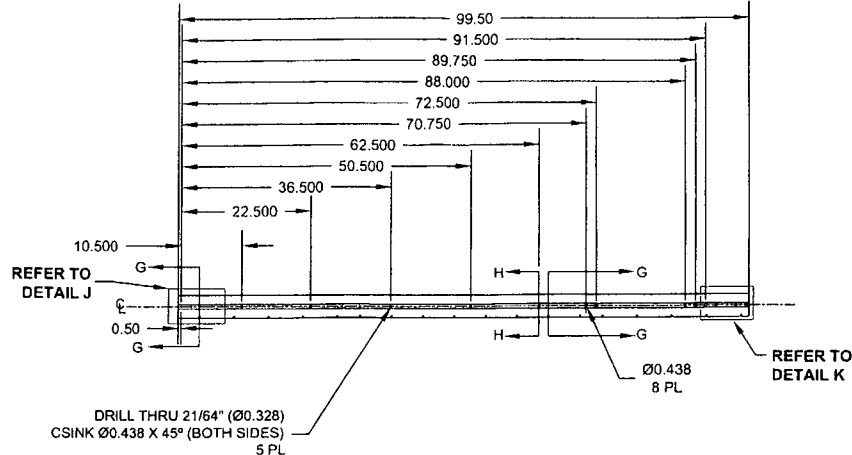


D3391-023 ASSEMBLY DETAIL

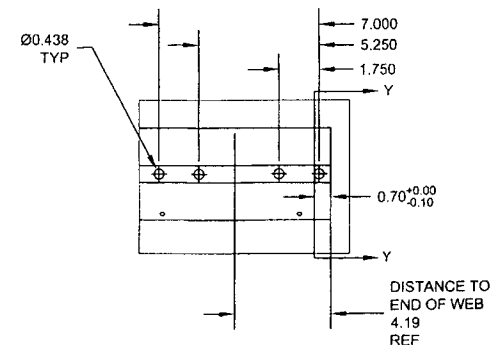


DETAIL K
SCALE 4X




SECTION G-G
SCALE 5X

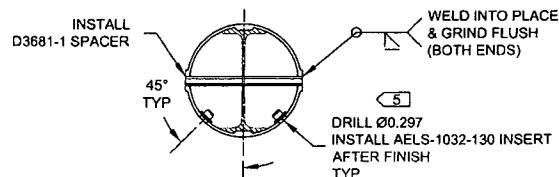

SECTION H-H
SCALE 5X

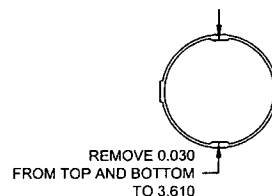

SECTION X-X
SCALE 5X

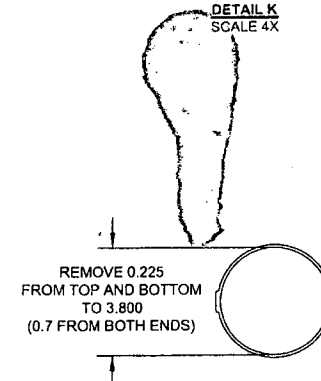

SECTION Y-Y
SCALE 5X

D3391-023 MID TUBE ASSEMBLY PARTS LIST

QTY - 023	PART NUMBER	DESCRIPTION
X	D3391-023	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
5	D3681-1	SPACER
20	AELS-1032-130	INSERT

D3391-023 MID TUBE ASSEMBLY

- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/291 PER QSI 015
- 3) WELDING: PER DART QSI 004

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 6 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DEO ATTACHED

RELEASED
08-09-05 W

71464


Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

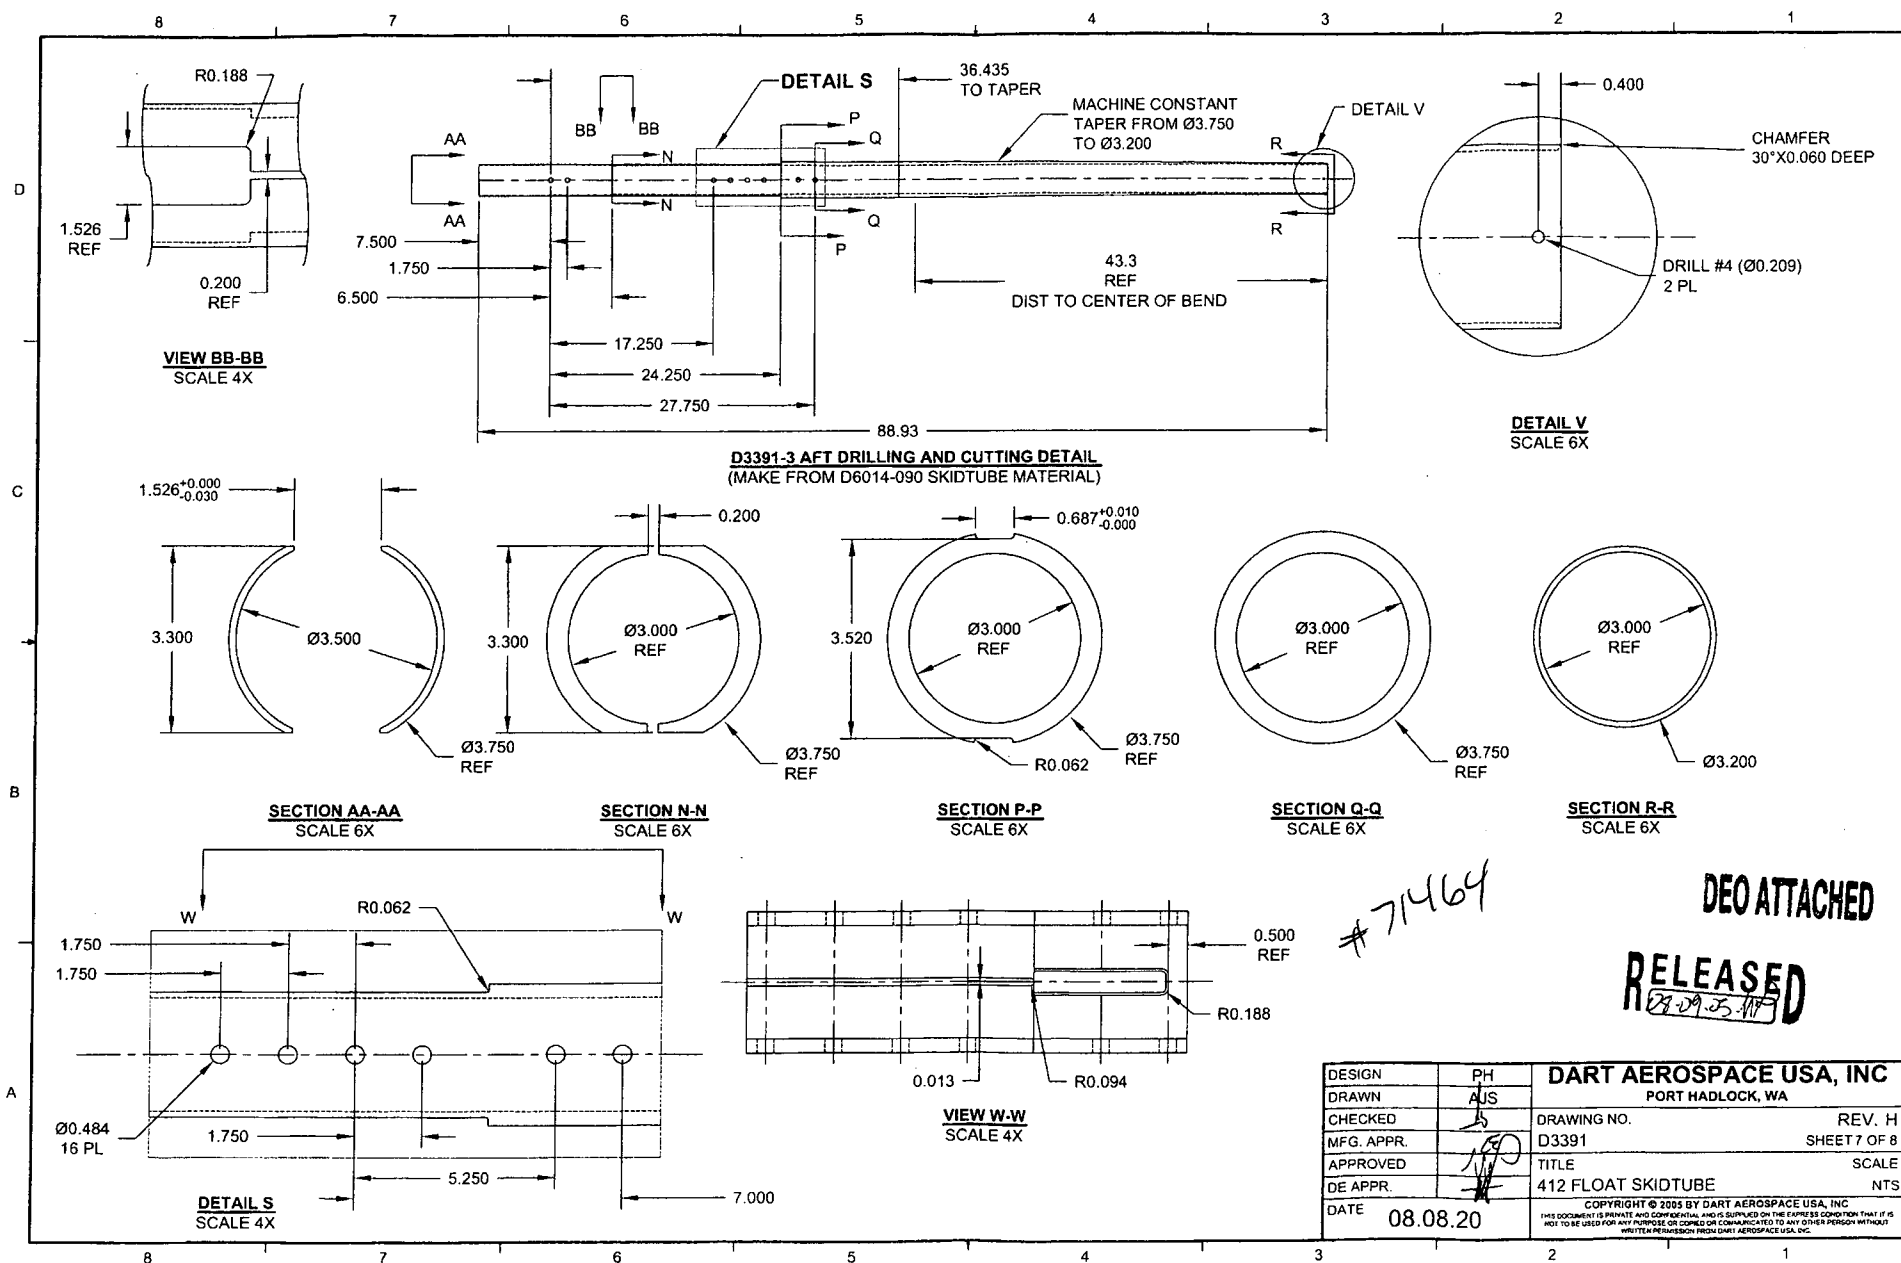

#71464

DEO ATTACHED
RELEASED
28-09-25-117

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED	5	DRAWING NO. D3391	REV. H
MFG. APPR.		SHEET 7 OF 8	
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	<small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMERCE OR COMMUNICATION TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

Dart Aerospace Ltd


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____


NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

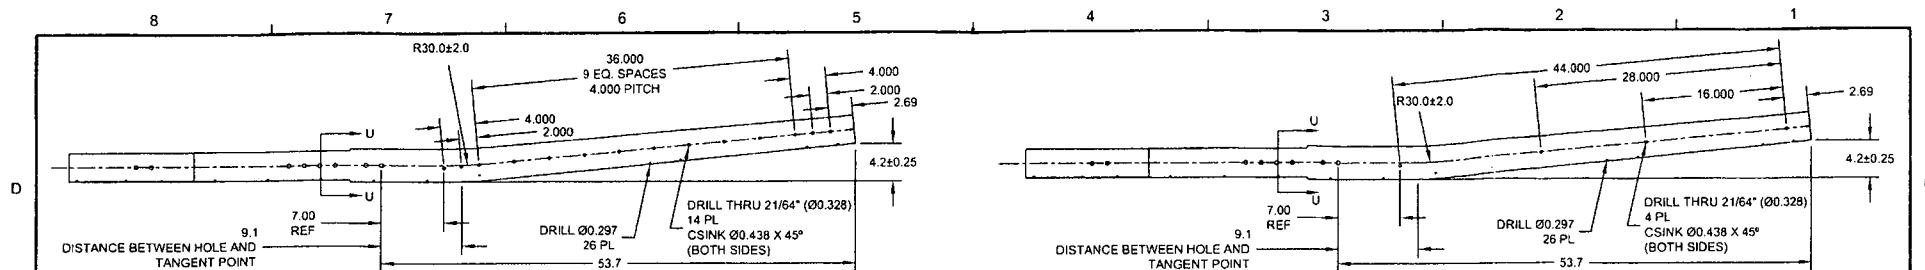


D3391-015 BENDING AND DRILLING DETAIL
(SEE CBORE DETAIL BELOW)

D3391-025 BENDING AND DRILLING DETAIL
(SEE CBORE DETAIL BELOW)

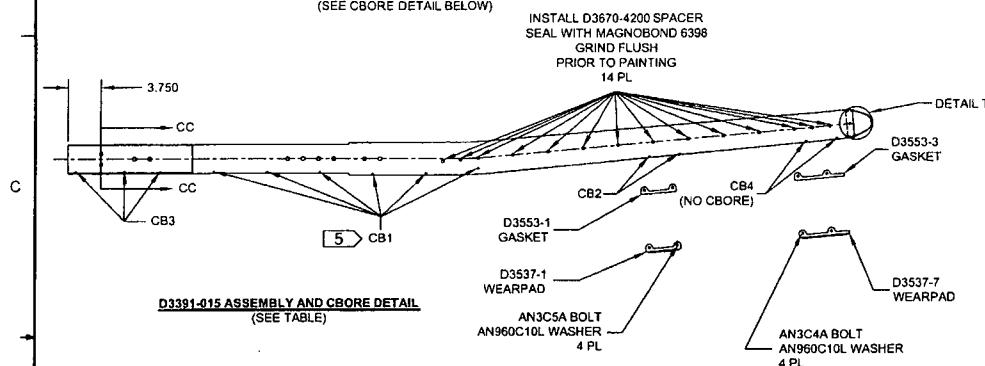


D3391-015 ASSEMBLY AND CBORE DETAIL
(SEE TABLE)

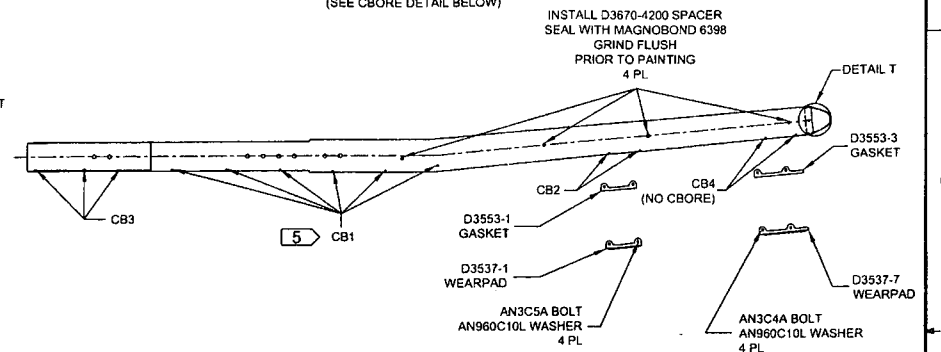


D3391-025 ASSEMBLY AND CBORE DETAIL
(SEE TABLE)

D3391-015/-025 AFT TUBE ASSEMBLY PARTS LIST

QTY - 015	QTY - 025	PART NUMBER	DESCRIPTION
X	X	D3391-015	AFT TUBE ASSEMBLY
		D3391-025	AFT TUBE ASSEMBLY
1	1	D6014-090	AFT TUBE
1	1	D2646	AFT CAP
1	1	D3537-1	WEARPAD
1	1	D3537-7	WEARPAD
1	1	D3553-1	GASKET
1	1	D3553-3	GASKET
14	4	D3670-4200	SPACER
2	2	D3672-1	WASHER
14	14	AELS-1032-130	INSERT
12	12	AELS-1032-225	INSERT
4		ALS4-428-165	INSERT
6	6	AN3C4A	BOLT
4	4	AN3C5A	BOLT
10	10	AN960C10L	WASHER

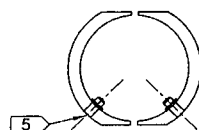


SECTION U-U
SCALE 3X

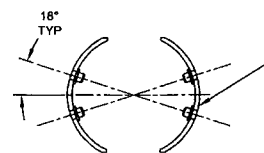

SECTION CC-CC
SCALE 3X

DRILL Ø0.391
CBORE Ø0.516 X 0.040 DEEP
INSTALL ALS4-428-165 INSERT
4 PL

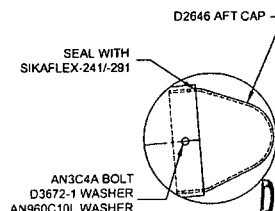

DETAIL T
SCALE 4X

CBORE HOLES MARKED CB1-CB4 AS FOLLOWS AND
INSTALL AELS-1032-XXX AFTER FINISH AS NOTED

HOLES MARKED	QTY D3391-015	QTY D3391-025	CBORE	P/N
CB1	12	12	Ø0.430 X 0.170	AELS-1032-225
CB2	4	4	Ø0.430 X 0.170	AELS-1032-130
CB3	6	6	Ø0.430 X 0.040	AELS-1032-130
CB4	4	4	NONE	AELS-1032-130

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 8 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DEO ATTACHED

RELEASED
08-09-05/10

#71464

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DRAWING NO. D3391	TITLE 412 FLOAT SKIDTUBE	REV. H	DART AEROSPACE USA, INC ENGINEERING ORDER		D.E.O. NO. D3391-H-1	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>UP</i>	CHECKED <i>h</i>	MFG. APPR. <i>AA</i>	APPROVED <i>MP</i>		DE APPR. <i>MP</i>		
DATE 09.09.23	DATE 06.09.24	DATE 09/09/25	DATE 09/09/30		DATE 09/09/30		

PURPOSE:

LPS-3 IS NO LONGER USED DURING ASSEMBLY OF D3391-041/-043 SKIDTUBES.

CHANGE:

AMEND NOTE 2 OF D3391-041/-043 SKIDTUBE ASSEMBLIES (ZN A6-1, A6-2) AS FOLLOWS:

- 2) ~~SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH~~
~~AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH~~
 LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS
 OFF POWDER COATING WITH MEK DEGREASER.

RELEASED
 2010-02-02

MP

7/11/04

COPYRIGHT © 2009 BY DART AEROSPACE USA, INC

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
 NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
 WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

H:\FORMS\Quality Assurance\approved QA\NCRWO RevE